

[4910-13-U]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39 [66 FR 18525 4/10/2001]

[Docket No. 2000-NM-178-AD; Amendment 39-12171; AD 2001-07-06]

RIN 2120-AA64

Airworthiness Directives; Saab Model SAAB 2000 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain Saab Model SAAB 2000 series airplanes, that requires a modification involving nondestructive test inspections of the 34 fastener holes in each rear wing spar, corrective action, if necessary, and cold working of the holes to increase fatigue life of the rear spar web. This amendment is prompted by issuance of mandatory continuing airworthiness information by a foreign civil airworthiness authority. The actions specified by this AD are intended to prevent fatigue cracking, which could result in fuel leakage and reduced structural integrity of the wings.

DATES: Effective May 15, 2001.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of May 15, 2001.

ADDRESSES: The service information referenced in this AD may be obtained from Saab Aircraft AB, SAAB Aircraft Product Support, S-581.88, Linköping, Sweden. This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2125; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain Saab Model SAAB 2000 series airplanes was published in the **Federal Register** on January 16, 2001 (66 FR 3516). That action proposed to require a modification involving nondestructive test inspections of the 34 fastener holes in each rear wing spar, corrective action, if necessary, and cold working of the holes to increase fatigue life of the rear spar web.

Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were submitted in response to the proposal or the FAA's determination of the cost to the public.

Conclusion

The FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

Cost Impact

The FAA estimates that 3 airplanes of U.S. registry will be affected by this AD, that it will take approximately 64 work hours per airplane to accomplish the required inspections and modification, and that the average labor rate is \$60 per work hour. Required parts will be supplied by the manufacturer without cost to the operators. Based on these figures, the cost impact of this AD on U.S. operators is estimated to be \$11,520, or \$3,840 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a “significant regulatory action” under Executive Order 12866; (2) is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption “ADDRESSES.”

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

AIRWORTHINESS DIRECTIVE



Aircraft Certification Service
Washington, DC

U.S. Department
of Transportation
**Federal Aviation
Administration**

We post ADs on the internet at "av-info.faa.gov"

The following Airworthiness Directive issued by the Federal Aviation Administration in accordance with the provisions of Title 14 of the Code of Federal Regulations (14 CFR) part 39, applies to an aircraft model of which our records indicate you may be the registered owner. Airworthiness Directives affect aviation safety and are regulations which require immediate attention. You are cautioned that no person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with the requirements of the Airworthiness Directive (reference 14 CFR part 39, subpart 39.3).

2001-07-06 SAAB AIRCRAFT AB: Amendment 39-12171. Docket 2000-NM-178-AD.

Applicability: Model SAAB 2000 series airplanes, serial numbers -003 through -063 inclusive; certificated in any category.

NOTE 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent fuel leakage and reduced structural integrity of the wings due to fatigue cracking, accomplish the following:

Modification

(a) Except as required by paragraph (b) of this AD: Prior to the accumulation of 13,000 total flight cycles, accomplish the modification of the rear spar on both wings (including applicable nondestructive test inspections to detect discrepancies (including cracking, scratches, or other damage, and incorrect hole size) and cold working of fastener holes), in accordance with Saab Service Bulletin 2000-57-037, dated April 13, 2000.

NOTE 2: For the purposes of this AD, a detailed visual inspection is defined as: "An intensive visual examination of a specific structural area, system, installation, or assembly to detect damage, failure, or irregularity. Available lighting is normally supplemented with a direct source of good lighting at intensity deemed appropriate by the inspector. Inspection aids such as mirror, magnifying lenses, etc., may be used. Surface cleaning and elaborate access procedures may be required."

Repair

(b) If any discrepancy is found during any inspection required by paragraph (a) of this AD, prior to further flight, repair in accordance with a method approved by the Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate, or the Luftfartsverket (LFV) (or its delegated agent). For a repair method to be approved by the Manager, International Branch, ANM-116, as required by this paragraph, the Manager's approval letter must specifically reference this AD.

Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, International Branch, ANM-116. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and who will then send the requests and comments to the Manager, International Branch, ANM-116.

NOTE 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the International Branch, ANM-116.

Special Flight Permits

(d) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(e) Except as provided by paragraph (b) of this AD, the actions shall be done in accordance with Saab Service Bulletin 2000-57-037, dated April 13, 2000. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Saab Aircraft AB, SAAB Aircraft Product Support, S-581.88, Linköping, Sweden. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

NOTE 4: The subject of this AD is addressed in Swedish airworthiness directive 1-157, dated April 13, 2000.

Effective Date

(f) This amendment becomes effective on May 15, 2001.

FOR FURTHER INFORMATION CONTACT: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2125; fax (425) 227-1149.

Issued in Renton, Washington, on April 2, 2001.

Donald L. Riggan, Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.